S108T01/S108T02 S208T01/S208T02

Low Profile Type Solid State Relays

■ Features

1. Low profile type (height : 16mm)
2. Built-in zero-cross circuit **(S108T02/S208T02)**
3. RMS ON-state current I_T : MAX. 8Arms
4. Approved by TÜV, No. R9750791 **(S208TY1/S208TY2)**
   Input-Output : Basic Insulation

■ Applications

1. Programmable controllers
2. Air conditioners
3. Copiers
4. Automatic vending machines

■ Model line-ups

	For 100V lines	For 200V lines
No zero-cross circuit	**S108T01**	**S208T01**
Built-in zero-cross circuit	**S108T02**	**S208T02**

■ Absolute Maximum Ratings (Ta=25°C)

	Parameter		Symbol	Rating	Unit
Input	Forward current		I_F	50	mA
	Reverse voltage		V_R	6	V
Output	RMS ON-state current		I_T	*1 8	A_{rms}
	*2 Peak one cycle surge current		I_{surge}	80	A
	Repetitive peak OFF-state voltage	**S108T01** **S108T02**	V_{DRM}	400	V
		S208T01 **S208T02**		600	
	Non-repetitive peak OFF-state voltage	**S108T01** **S108T02**	V_{DSM}	400	V
		S208T01 **S208T02**		600	
	Critical rate of rise of ON-state current		dI_T/dt	50	A/μs
	Operating frequency		f	45 to 65	Hz
	Operating temperature		T_{opr}	–25 to +100	°C
	Storage temperature		T_{stg}	–30 to +125	°C
	*3 Isolation voltage		V_{iso}	3.0	kV_{rms}
	*4 Soldering temperature		T_{sol}	260	°C

*1 Refer to Fig.2, Fig.3
*2 60Hz sine wave, start at Tj=25°C
*3 Isolation voltage measuring method
(1) Dielectric withstand voltage tester with zero cross circuit shall be used.
(2) The applied voltage waveform shall be sine wave.
(3) Voltage shall be applied between input and output.
(Input and output terminals shall be shorted respectively.)
(4) AC 60Hz, 1min, 40 to 60%RH.
*4 For 10s

■ Outline Dimensions (Unit : mm)

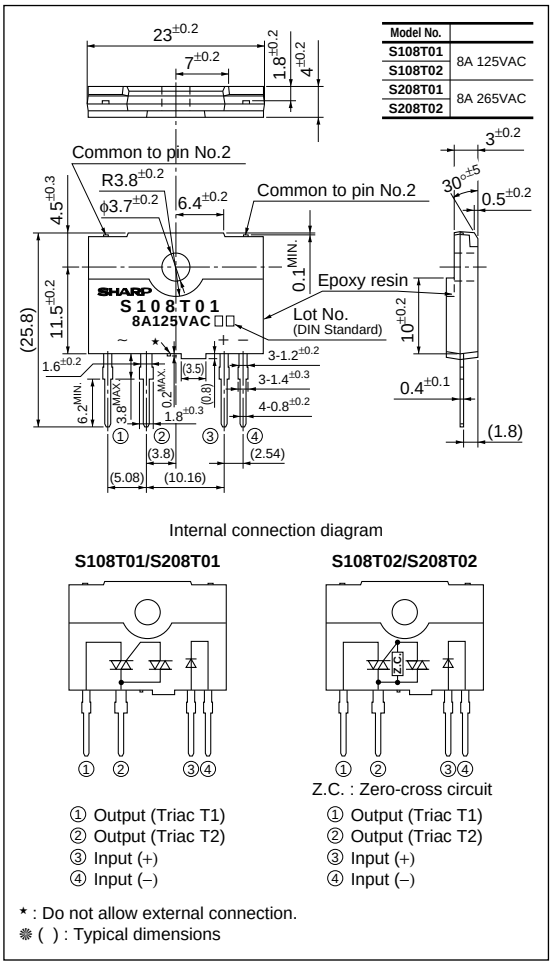

■ Electrical Characteristics

(Ta=25°C)

	Parameter		Symbol	Conditions	MIN.	TYP.	MAX.	Unit
Input	Forward voltage		V_F	I_F=20mA	–	1.2	1.4	V
	Reverse current		I_R	V_R=3V	–	–	1×10^{-4}	A
Output	Repetitive peak OFF-state current		I_{DRM}	$V_D=V_{DRM}$	–	–	1×10^{-4}	A
	ON-state voltage		V_T	I_T=2A_{rms}, Resistance load, I_F=20mA	–	–	1.5	V_{rms}
	Holding current		I_H	–	–	–	50	mA
	Critical rate of rise of OFF-state voltage		dV/dt	V_D=2/3V_{DRM}	30	–	–	V/μs
	Critical rate of rise of OFF-state voltage at commutaion		$(dV/dt)_C$	T_j=125°C, V_D=2/3V_{DRM}, dI_t/dt=–4A/ms	5	–	–	V/μs
Transfer characteristics	Minimum trigger current	S108T01/S208T01	I_{FT}	V_D=12V, R_L=30Ω	–	–	8	mA
		S108T02/S208T02		V_D=6V, R_L=30Ω				
	Zero cross voltage	S108T02/S208T02	V_{OX}	I_F=8mA	–	–	35	V
	Isolation resistance		R_{iso}	DC500V, 40 to 60%RH	1×10^{10}	–	–	Ω
	Turn-on time	S108T01	t_{on}	V_D=100V_{rms}, AC50Hz, I_T=2A_{rms}, Resistance load, I_F=20mA	–	–	1	ms
		S208T01						
		S108T02		V_D=200V_{rms}, AC50Hz, I_T=2A_{rms}, Resistance load, I_F=20mA			10	
		S208T02						
	Turn-off time	S108T01	t_{off}	V_D=100V_{rms}, AC50Hz, I_T=2A_{rms}, Resistance load, I_F=20mA	–	–	10	ms
		S108T02						
		S208T01		V_D=200V_{rms}, AC50Hz, I_T=2A_{rms}, Resistance load, I_F=20mA				
		S208T02						
Thermal resistance (Between junction and case)			R_{th}(j-c)	–	–	4.5	–	°C/W
Thermal resistance (Between junction and ambience)			R_{th}(j-a)	–	–	40		

Fig.1 Forward Current vs. Ambient Temperature

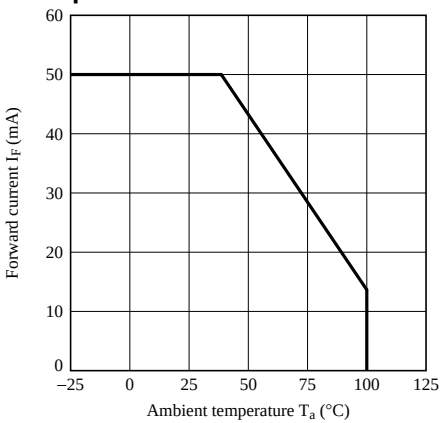

Fig.2 RMS ON-state Current vs. Ambient Temperature

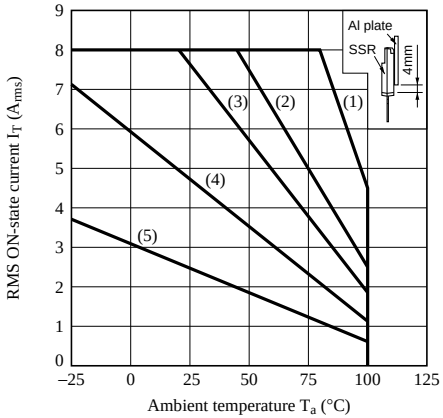

(1) With infinite heat sink
(2) With heat sink (200×200×2mm Al plate)
(3) With heat sink (100×100×2mm Al plate)
(4) With heat sink (50×50×2mm Al plate)
(5) Without heat sink
(Note) With the Al heat sink set up vertically, tighten the device with a torque of 0.4N•m and apply thermal conductive silicone grease on the mounting face of heat sink. Forced cooling shall not be carried out. (Please use an isolation sheet if necessary.)

Fig.3 RMS ON-state Current vs. Case Temperature

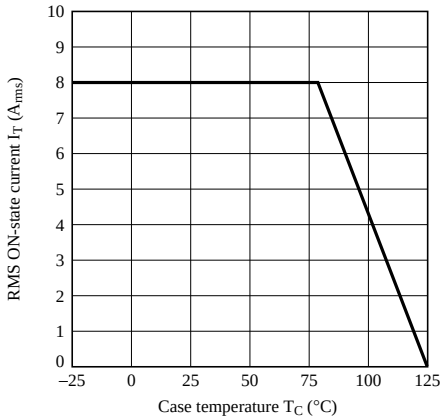

Fig.4 Forward Current vs. Forward Voltage

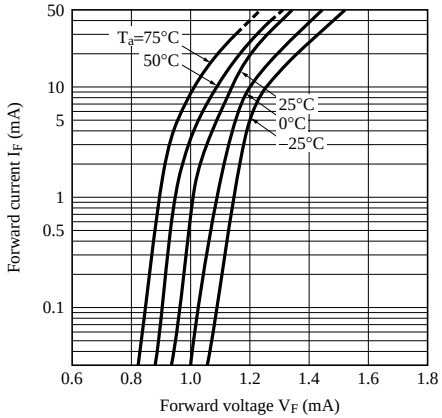

Fig.5 Surge Current vs. Power-on Cycle

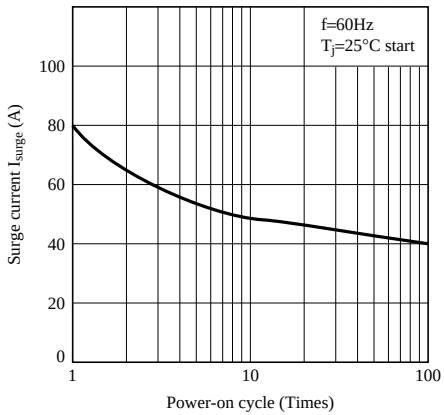

Fig.6 Minimum Trigger Current vs. Ambient Temperature (Typical Value)

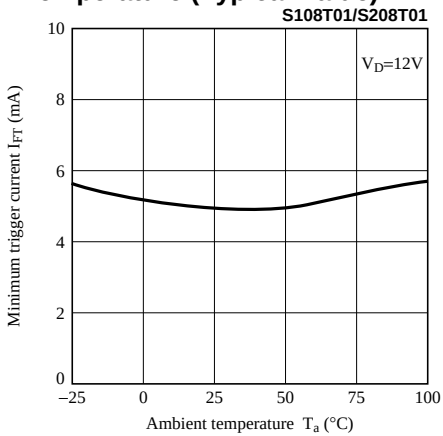

Fig.7 Minimum Trigger Current vs. Ambient Temperature (Typical Value)

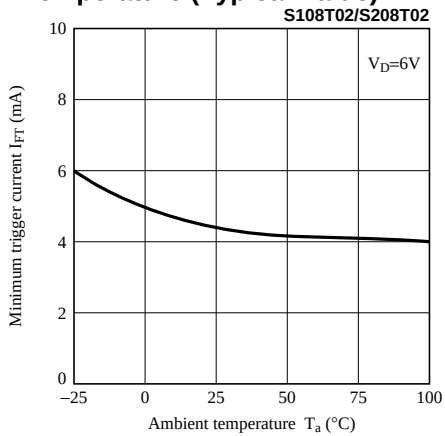

Fig.8 Maximum ON-state Power Dissipation vs. RMS ON-state Current (Typical Value)

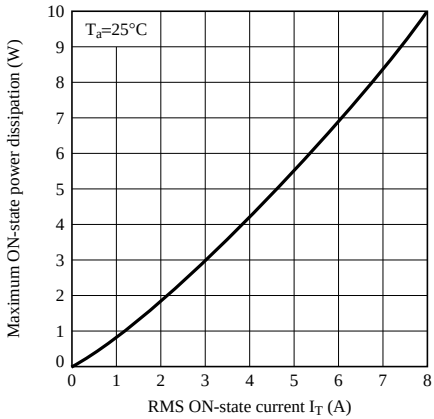

Fig.9 Repetitive Peak OFF-state Current vs. Ambient Temperature

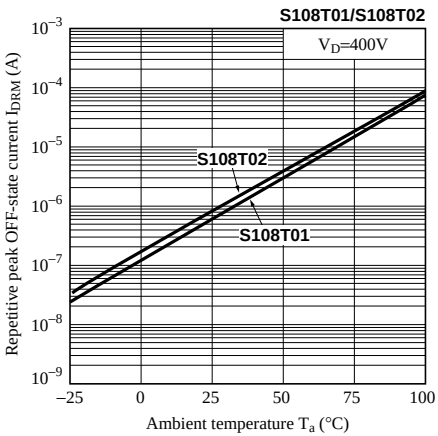

Fig.10 Repetitive Peak OFF-state Current vs. Ambient Temperature

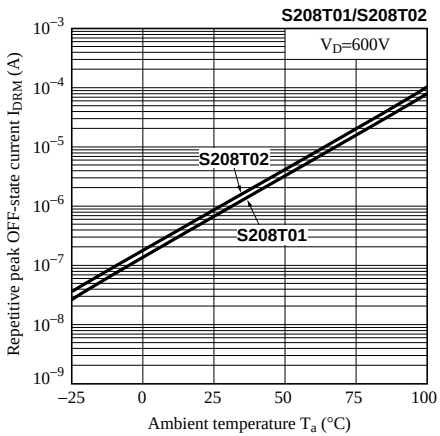

NOTICE

- The circuit application examples in this publication are provided to explain representative applications of SHARP devices and are not intended to guarantee any circuit design or license any intellectual property rights. SHARP takes no responsibility for any problems related to any intellectual property right of a third party resulting from the use of SHARP's devices.
- Contact SHARP in order to obtain the latest device specification sheets before using any SHARP device. SHARP reserves the right to make changes in the specifications, characteristics, data, materials, structure, and other contents described herein at any time without notice in order to improve design or reliability. Manufacturing locations are also subject to change without notice.
- Observe the following points when using any devices in this publication. SHARP takes no responsibility for damage caused by improper use of the devices which does not meet the conditions and absolute maximum ratings to be used specified in the relevant specification sheet nor meet the following conditions:

(i) The devices in this publication are designed for use in general electronic equipment designs such as:
— Personal computers
— Office automation equipment
— Telecommunication equipment [terminal]
— Test and measurement equipment
— Industrial control
— Audio visual equipment
— Consumer electronics

(ii) Measures such as fail-safe function and redundant design should be taken to ensure reliability and safety when SHARP devices are used for or in connection with equipment that requires higher reliability such as:
— Transportation control and safety equipment (i.e., aircraft, trains, automobiles, etc.)
— Traffic signals
— Gas leakage sensor breakers
— Alarm equipment
— Various safety devices, etc.

(iii) SHARP devices shall not be used for or in connection with equipment that requires an extremely high level of reliability and safety such as:
— Space applications
— Telecommunication equipment [trunk lines]
— Nuclear power control equipment
— Medical and other life support equipment (e.g., scuba).

- Contact a SHARP representative in advance when intending to use SHARP devices for any "specific" applications other than those recommended by SHARP or when it is unclear which category mentioned above controls the intended use.
- If the SHARP devices listed in this publication fall within the scope of strategic products described in the Foreign Exchange and Foreign Trade Control Law of Japan, it is necessary to obtain approval to export such SHARP devices.
-
- Contact and consult with a SHARP representative if there are any questions about the contents of this publication.